



# MATERIAL SAFETY DATA SHEET

**MATERION**

## 1. Chemical product and company identification

**A. Product name** Vit105

**C. Supplier information**

**Company name** Materion Brush Inc.  
**Address** 6070 Parkland Boulevard  
Mayfield Heights OH 44124  
United States

**Email** ehs@materion.com  
**Emergency telephone number** +1.216.383.4019

**MSDS number** M38

## 2. Hazards identification

### A. Hazard category/Classification

**Physical hazards** Not classified.

**Health hazards** Sensitization, skin Category 1  
Carcinogenicity Category 1  
Specific target organ toxicity, repeated exposure Category 1 (Respiratory system)

**Environmental hazards** Not classified.

### B. Warning label items including precautionary statement

• **Pictogram**



• **Signal word**

Danger

• **Hazard statement**

H317 May cause an allergic skin reaction.  
H350i May cause cancer by inhalation.  
H372 Causes damage to organs (respiratory system) through prolonged or repeated exposure by inhalation.

• **Precautionary statement**

**Prevention**

P201 Obtain special instructions before use.  
P202 Do not handle until all safety precautions have been read and understood.  
P260 Do not breathe dust/fume.  
P264 Wash thoroughly after handling.  
P270 Do not eat, drink or smoke when using this product.  
P272 Contaminated work clothing must not be allowed out of the workplace.  
P280 Wear protective gloves/protective clothing/eye protection/face protection.  
P284 In case of inadequate ventilation wear respiratory protection.

**Response**

P302 + P350 If on skin: Wash with plenty of water.  
P304 + P340 If inhaled: Remove person to fresh air and keep comfortable for breathing.  
P308 + P313 If exposed or concerned: Get medical advice/attention.  
P333 + P313 If skin irritation or rash occurs: Get medical advice/attention.  
P342 + P311 If experiencing respiratory symptoms: Call a poison center/doctor.  
P363 Wash contaminated clothing before reuse.

## Storage

P405 Store locked up.

## Disposal

P501 Dispose of contents/container in accordance with local/regional/national/international regulations.

**C. Other hazards not included in the hazard category criteria (e.g. dust explosion hazard)** None known.

**Supplemental information** For further information, please contact the Product Stewardship Department at +1.216.383.4019.

## 3. Composition/information on ingredients

Chemical identity	Common and alternative names	CAS number	ID number	Content in percent (%)
Zirconium		7440-67-7	KE-35607	56 - 73
Copper		7440-50-8	KE-08896	15 - 20
Nickel		7440-02-0	KE-25818	10 - 14
Aluminum		7429-90-5	KE-00881	1 - 5
Titanium		7440-32-6	KE-33881	1 - 5
Beryllium		7440-41-7	KE-02829	0 - 0.1

## 4. First aid measures

**A. In case of eye contact** Immediately flush eyes with plenty of water for at least 15 minutes, lifting lower and upper eyelids occasionally. Get medical attention if symptoms persist.

**B. In case of skin contact** Take off contaminated clothing and wash before reuse. Thoroughly wash skin cuts or wounds to remove all particulate debris from the wound. Seek medical attention for wounds that cannot be thoroughly cleansed. Treat skin cuts and wounds with standard first aid practices such as cleansing, disinfecting and covering to prevent wound infection and contamination before continuing work. Obtain medical help for persistent irritation. Material accidentally implanted or lodged under the skin must be removed.

**C. In case of inhalation** If symptoms develop move victim to fresh air. For breathing difficulties, oxygen may be necessary. Breathing difficulty caused by inhalation of particulate requires immediate removal to fresh air. If breathing has stopped, perform artificial respiration and obtain medical help.

**D. In case of swallowing** If swallowed, seek medical advice immediately and show this container or label. Induce vomiting immediately as directed by medical personnel. Never give anything by mouth to an unconscious person.

**E. Note to physician** Treatment of Chronic Beryllium Disease: There is no known treatment which will cure chronic beryllium disease. Prednisone or other corticosteroids are the most specific treatment currently available. They are directed at suppressing the immunological reaction and can be effective in diminishing signs and symptoms of chronic beryllium disease. In cases where steroid therapy has had only partial or minimal effectiveness, other immunosuppressive agents, such as cyclophosphamide, cyclosporine, or methotrexate, have been used. These latter agents remain investigational. Further, in view of the potential side effects of all the immunosuppressive medications, including steroids such as prednisone, they should be used only under the direct care of a physician. In general, these medications should be reserved for cases with significant symptoms and/or significant loss of lung function. Other symptomatic treatment, such as oxygen, inhaled steroids or bronchodilators, may be prescribed by some physicians and can be effective in selected cases.

The decision about when and with what medication to treat is a judgment situation for individual physicians. For the most part, treatment is reserved for those persons with symptoms and measurable loss of lung function. The value of starting oral steroid treatment, before signs or symptoms are evident, remains a medically unresolved issue.

The effects of continued low exposure to beryllium are unknown for individuals who are sensitized to beryllium or who have a diagnosis of chronic beryllium disease. It is generally recommended that persons who are sensitized to beryllium or who have CBD terminate their occupational exposure to beryllium.

**General advice** If exposed or concerned: get medical attention/advice. Get medical attention if symptoms occur. Wash contaminated clothing before reuse. As supplied, there is no immediate medical risk with beryllium products in article form. First aid measures provided are related to particulate containing beryllium.

## 5. Fire-fighting measures

### A. Suitable (and unsuitable) extinguishing media

**Suitable extinguishing media** The product is non-combustible. Use extinguishing measures that are appropriate to local circumstances and the surrounding environment.

**Unsuitable extinguishing media** Do not use water to extinguish fires around operations involving molten metal due to the potential for steam explosions.

**B. Specific hazards arising from the chemical (example: hazardous combustion products)** Not available.

### C. Specific methods of fire-fighting

**Special protective equipment for firefighters** Firefighters should wear full protective clothing including self contained breathing apparatus. Wear suitable protective equipment.

**Special fire fighting procedures** Move containers from fire area if you can do so without risk. Water runoff can cause environmental damage.

**Specific methods** Pressure-demand self-contained breathing apparatus must be worn by firefighters or any other persons potentially exposed to the particulate released during or after a fire.

## 6. Accidental release measures

**A. Personal precautions, protective equipment and emergency measures** In solid form this material poses no special clean-up problems. Wear appropriate protective equipment and clothing during clean-up.

**B. Environmental precautions** Avoid release to the environment. In the event of a spill or accidental release, notify relevant authorities in accordance with all applicable regulations. Prevent further leakage or spillage if safe to do so. Avoid discharge into drains, water courses or onto the ground.

**C. Methods and materials for containment and cleaning up** Clean up in accordance with all applicable regulations.

## 7. Handling and storage

**A. Precautions for safe handling** Obtain special instructions before use. Do not handle until all safety precautions have been read and understood. Minimize dust generation and accumulation. Do not breathe dust/fume. Wear protective gloves/protective clothing/eye protection/face protection. Wear respiratory protection. Wash thoroughly after handling. When using, do not eat, drink or smoke. Contaminated work clothing must not be allowed out of the workplace.

**B. Conditions for safe storage (including any incompatibilities)** Keep locked-up. Avoid contact with acids and alkalis. Avoid contact with oxidizing agents.

## 8. Exposure controls/personal protection

### A. Exposure limit values, biological limit values, etc

Korea. OELs. Standards for Exposure to Chemical Substances and Physically Hazardous Factors

Components	Type	Value	Form
Aluminum (CAS 7429-90-5)	TWA	5 mg/m <sup>3</sup>	Welding fume.
		5 mg/m <sup>3</sup>	Pyrophoric powder.
		2 mg/m <sup>3</sup>	
		10 mg/m <sup>3</sup>	Dust.
Beryllium (CAS 7440-41-7)	STEL	0.01 mg/m <sup>3</sup>	
	TWA	0.002 mg/m <sup>3</sup>	
Copper (CAS 7440-50-8)	STEL	2 mg/m <sup>3</sup>	Dust and mist.
	TWA	1 mg/m <sup>3</sup>	Dust and mist.
		0.1 mg/m <sup>3</sup>	Fume.
Nickel (CAS 7440-02-0)	TWA	1 mg/m <sup>3</sup>	

**Biological limit values** No biological exposure limits noted for the ingredient(s).

## Exposure guidelines

### Korea OELs: Skin designation

Beryllium (CAS 7440-41-7)

Substance can be absorbed through membrane, eye and skin and can cause whole body effects (It does not mean skin irritant).

### B. Appropriate engineering controls

**VENTILATION:** Good general ventilation (typically 10 air changes per hour) should be used. Ventilation rates should be matched to conditions. If applicable, use process enclosures, local exhaust ventilation, or other engineering controls to maintain airborne levels below recommended exposure limits. If exposure limits have not been established, maintain airborne levels to an acceptable level.

Whenever possible, the use of local exhaust ventilation or other engineering controls is the preferred method of controlling exposure to airborne particulate. Where utilized, exhaust inlets to the ventilation system must be positioned as close as possible to the source of airborne generation. Avoid disruption of the airflow in the area of a local exhaust inlet by equipment such as a man-cooling fan. Check ventilation equipment regularly to ensure it is functioning properly. Provide training on the use and operation of ventilation to all users. Use qualified professionals to design and install ventilation systems.

**WET METHODS:** Machining operations are usually performed under a liquid lubricant/coolant flood which assists in reducing airborne particulate. However, the cycling through of machine coolant containing finely divided particulate in suspension can result in the concentration building to a point where the particulate may become airborne during use. Certain processes such as sanding and grinding may require complete hooded containment and local exhaust ventilation. Prevent coolant from splashing onto floor areas, external structures or operators' clothing. Utilize a coolant filtering system to remove particulate from the coolant.

**WORK PRACTICES:** Develop work practices and procedures that prevent particulate from coming in contact with worker skin, hair, or personal clothing. If work practices and/or procedures are ineffective in controlling airborne exposure or visual particulate from deposition on skin, hair, or clothing, provide appropriate cleaning/washing facilities. Procedures should be written that clearly communicate the facility's requirements for protective clothing and personal hygiene. These clothing and personal hygiene requirements help keep particulate from being spread to non-production areas or from being taken home by the worker. Never use compressed air to clean work clothing or other surfaces.

Fabrication processes may leave a residue of particulate on the surface of parts, products or equipment that could result in employee exposure during subsequent material handling activities. As necessary, clean loose particulate from parts between processing steps. As a standard hygiene practice, wash hands before eating or smoking.

**HOUSEKEEPING:** Use vacuum and wet cleaning methods for particulate removal from surfaces. Be certain to de-energize electrical systems, as necessary, before beginning wet cleaning. Use vacuum cleaners with high efficiency particulate air (HEPA). Do not use compressed air, brooms, or conventional vacuum cleaners to remove particulate from surfaces as this activity can result in elevated exposures to airborne particulate. Follow the manufacturer's instructions when performing maintenance on HEPA filtered vacuums used to clean hazardous materials.

### C. Personal protective equipment

#### • Respiratory protection

When airborne exposures exceed or have the potential to exceed the occupational exposure limits, approved respirators must be used as specified by an Industrial Hygienist or other qualified professional. Respirator users must be medically evaluated to determine if they are physically capable of wearing a respirator. Quantitative and/or qualitative fit testing and respirator training must be satisfactorily completed by all personnel prior to respirator use. Users of tight fitting respirators must be clean shaven on those areas of the face where the respirator seal contacts the face. Use pressure-demand airline respirators when performing jobs with high potential exposures such as changing filters in a baghouse air cleaning device.

#### • Eye protection

Wear approved safety glasses, goggles, face shield and/or welder's helmet when risk of eye injury is present, particularly during operations that generate dust, mist or fume.

#### • Hand protection

Wear gloves to prevent contact with particulate or solutions. Wear gloves to prevent metal cuts and skin abrasions during handling.

- **Body protection** Personal protection equipment should be chosen according to the CEN standards and in discussion with the supplier of the personal protective equipment. Protective overgarments or work clothing must be worn by persons who may become contaminated with particulate during activities. Skin contact with this material may cause, in some sensitive individuals, an allergic dermal response. Particulate that becomes lodged under the skin has the potential to induce sensitization and skin lesions.

**Hygiene measures** Handle in accordance with good industrial hygiene and safety practice.

## 9. Physical and chemical properties

### A. Appearance

**Physical state** Solid.  
**Form** Various shapes.  
**Color** Metallic.

**B. Odor** Not available.

**C. Odor threshold** Not applicable.

**D. pH** Not applicable.

### E. Melting point/freezing point

**Melting point** 1220 °F (660 °C) estimated

**Freezing point** 1220 °F (660 °C) estimated

**F. Boiling point, initial boiling point, and boiling range** 4220.6 °F (2327 °C) estimated

**G. Flash point** Not applicable.

**H. Evaporation rate** Not applicable.

**I. Flammability (solid, gas)** Not applicable.

### J. Upper/lower limit on flammability or explosive limits

**Flammability limit - lower (%)** Not applicable.

**Flammability limit - upper (%)** Not applicable.

**Explosive limit - lower (%)** Not applicable.

**Explosive limit - upper (%)** Not applicable.

**K. Vapor pressure** 0.22 hPa estimated

### L. Solubility

**Solubility (water)** Not applicable.

**M. Vapor density** Not applicable.

**N. Specific gravity** 8.02 estimated

**O. n-octanol/water partition coefficient** Not available.

**P. Auto-ignition temperature** Not applicable.

**Q. Decomposition temperature** Not applicable.

**R. Viscosity** Not applicable.

**S. Molecular weight** Not available.

### Other data

**Density** 8.02 g/cm<sup>3</sup> estimated

**Explosive properties** Not explosive.

**Oxidizing properties** Not oxidizing.

**Relative density** Not applicable.

## 10. Stability and reactivity

**Reactivity** The product is stable and non-reactive under normal conditions of use, storage and transport.

### A. Stability and hazardous reaction potential

**Stability** Material is stable under normal conditions.

<b>Hazardous reaction potential</b>	Hazardous polymerization does not occur.
<b>B. Conditions to avoid (e.g. static discharge, shock or vibration, etc)</b>	Avoid dust formation. Contact with acids. Contact with alkalis.
<b>C. Incompatible materials</b>	Strong acids, alkalies and oxidizing agents.
<b>D. Hazardous decomposition products</b>	No hazardous decomposition products are known.

## 11. Toxicological information

### A. Information on likely routes of exposure

- **Respiratory organs** May cause sensitization by inhalation. May cause allergy or asthma symptoms or breathing difficulties if inhaled. May cause damage to organs (respiratory system) through prolonged or repeated exposure.
- **Skin** May cause an allergic skin reaction.
- **Eyes** Harmful in contact with eyes.
- **Mouth** Toxic if swallowed.

### B. Information on health hazards

- **Acute toxicity (list all possible routes of exposure)** May cause allergic skin reaction.
- **Corrosivity or irritation to the skin** Not likely, due to the form of the product.
- **Serious eye damage/eye irritation** Harmful in contact with eyes.
- **Respiratory sensitization** May cause damage to organs (respiratory system) through prolonged or repeated exposure.
- **Skin sensitization** May cause an allergic skin reaction.
- **Carcinogenic properties /Carcinogenicity** Cancer hazard.

#### IARC Monographs. Overall Evaluation of Carcinogenicity

Beryllium (CAS 7440-41-7)

1 Carcinogenic to humans.

Nickel (CAS 7440-02-0)

2B Possibly carcinogenic to humans.

- **Mutagenic properties /Mutagenicity** Due to lack of data the classification is not possible.
- **Reproductive toxicity** Not classified.
- **Specific target organ toxicity - single exposure** May cause allergy or asthma symptoms or breathing difficulties if inhaled.
- **Specific target organ toxicity - repeated exposure** May cause damage to organs (respiratory system) through prolonged or repeated exposure by inhalation.
- **Aspiration hazard** Due to lack of data the classification is not possible.

## 12. Ecological information

<b>A. Ecotoxicity</b>	No data available.
<b>Hazardous to the aquatic environment, acute hazard</b>	Not available.
<b>Hazardous to the aquatic environment, long-term hazard</b>	Not available.
<b>B. Persistence/degradability</b>	No data is available on the degradability of this product.
<b>C. Bioaccumulative potential</b>	Not available.
<b>D. Mobility in soil</b>	Not available.
<b>E. Other adverse effects</b>	Not available.

### 13. Disposal considerations

#### A. Method of disposal

Material should be recycled if possible. Disposal recommendations are based on material as supplied. Disposal must be in accordance with current applicable laws and regulations, and material characteristics at time of disposal.

#### B. Disposal considerations (including disposal of contaminated containers or packaging)

Empty containers should be taken to an approved waste handling site for recycling or disposal. Since emptied containers may retain product residue, follow label warnings even after container is emptied.

### 14. Transport information

#### IATA

A. UN number	UN3178
B. UN proper shipping name	Flammable solid, inorganic, n.o.s. (Zirconium)
C. Transport hazard class(es)	
Class	4.1
Subsidiary risk	-
D. Packing group	III
E. Environmental hazards	No.
ERG Code	3L
F. Special precautions for user	Not applicable.
Other information	
Passenger and cargo aircraft	Allowed.
Cargo aircraft only	Allowed.


#### IMDG

A. UN number	UN3178
B. UN proper shipping name	FLAMMABLE SOLID, INORGANIC, N.O.S. (Zirconium)
C. Transport hazard class(es)	
Class	4.1
Subsidiary risk	-
D. Packing group	III
E. Environmental hazards	
Marine pollutant	No.
EmS	F-A, S-G
F. Special precautions for user	Not applicable.

Transport in bulk according to Annex II of MARPOL 73/78 and the IBC Code

Not available.

#### IATA; IMDG

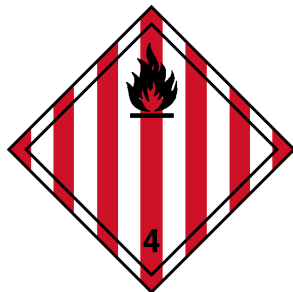

### 15. Regulatory information

#### A. Restrictions under the Industrial Safety and Health Law

##### Harmful Substances Prohibited from Manufacturing

Not regulated.

##### Harmful Substances Requiring Permission for Manufacture or Use

Not regulated.

**Controlled Hazardous Substances**

- Aluminum (CAS 7429-90-5)
- Copper (CAS 7440-50-8)
- Zirconium (CAS 7440-67-7)
- Nickel (CAS 7440-02-0)

**Harmful Substances Requiring Special Medical Examination**

- Aluminum (CAS 7429-90-5)
- Copper (CAS 7440-50-8)
- Nickel (CAS 7440-02-0)
- Zirconium (CAS 7440-67-7)

**Workplace Environmental Monitoring Harmful Materials**

- Aluminum (CAS 7429-90-5)
- Copper (CAS 7440-50-8)
- Nickel (CAS 7440-02-0)
- Zirconium (CAS 7440-67-7)

**Occupational Exposure Limit**

- Aluminum (CAS 7429-90-5)
- Beryllium (CAS 7440-41-7)
- Copper (CAS 7440-50-8)
- Nickel (CAS 7440-02-0)

**B. Restrictions under the Toxic Chemicals Control Law**

**Accidental Release Prevention Substances**

Not regulated.

**Banned Toxic Chemicals**

Not regulated.

**Observational Chemicals**

Not regulated.

**Restricted Chemical Substances**

Not regulated.

**Toxic Chemicals**

Not regulated.

**C. Restrictions under the Dangerous Substance Safety Management Act**

**D. Restrictions under the Wastes Control Act**

**Halogenated Materials in Waste Organic Solvents**

Not regulated.

**Hazardous Substances**

Copper (CAS 7440-50-8)

Hazardous substances in slag, dust, waste molding sand & sand from sand blast, waste refractories & ceramic pieces, residues of incineration, materials treated for stabilization, & waste catalysts 3 MG/L

Hazardous substances in sludge, waste absorbers and absorbers 3 MG/L

**E. Restrictions under other foreign or domestic laws**

**Clean Air Conservation Act**

**Air Pollutants**

- Aluminum (CAS 7429-90-5)
- Beryllium (CAS 7440-41-7)
- Copper (CAS 7440-50-8)
- Nickel (CAS 7440-02-0)

**Specific Air Pollutants**

- Beryllium (CAS 7440-41-7)
- Nickel (CAS 7440-02-0)

**Further information**

This material safety data sheet was prepared in accordance with Article 41 of the Industrial Safety and Health Law.



## Inventory status

Country(s) or region	Inventory name	On inventory (yes/no)*
Korea	Existing Chemicals List (ECL)	Yes

\*A "Yes" indicates that all components of this product comply with the inventory requirements administered by the governing country(s)

A "No" indicates that one or more components of the product are not listed or exempt from listing on the inventory administered by the governing country(s).

## 16. Other information

<b>A. Source of information</b>	Not available.
<b>B. Issue date</b>	12-11-2015
<b>C. Number of revisions and date of most recent revision</b>	02-02-2016 (02 revision)
<b>D. Other</b>	Corrected health hazard classifications.
<b>Further information</b>	Transportation Emergency Call Chemtrec at: Domestic: 800.424.9300 International: 703.527.3887

**Disclaimer** This document has been prepared using data from sources considered to be technically reliable and the information is believed to be correct. Materion makes no warranties, expressed or implied, as to the accuracy of the information contained herein. Materion cannot anticipate all conditions under which this information and its products may be used and the actual conditions of use are beyond its control. The user is responsible to evaluate all available information when using this product for any particular use and to comply with all Federal, State, Provincial and Local laws, statutes and regulations.

**Revision Information** Hazards identification: • Hazard statement  
Toxicological information: • Acute toxicity (list all possible routes of exposure)  
Toxicological information: • Respiratory sensitization  
Toxicological information: • Specific target organ toxicity - repeated exposure  
Other information: D. Other  
GHS: Classification